

Brookside Cemetery Treatment Report 2019



For City of Dayton

By Historic Preservation Northwest

December 16, 2019

Brookside Cemetery Treatment Report 2019

Written by: David Pinyerd and Bernadette Niederer
Historic Preservation Northwest
1116 11th Ave SW
Albany OR 97321
541-791-9199
www.hp-nw.com

Written for: City of Dayton

Completed: December 16, 2019

This publication has been funded with the assistance of a matching grant-in-aid from the Oregon State Historic Preservation Office and the National Park Service. Regulations of the U.S. Department of the Interior strictly prohibit unlawful discrimination on the basis of race, color, national origin, age or handicap. Any person who believes he or she has been discriminated against in any program, activity, or facility operated by a recipient of Federal assistance should write to: Office of Equal Opportunity, National Park Service, 1849 C Street, NW, Washington, D.C. 20240.

All photographs in this document were taken by HPNW unless otherwise noted.

Hyperlinks are denoted in blue, underlined text. Clicking on them with your mouse will take you to a website or to another place within the document.

Front Cover: Excavation and repair sequence of the Francis A. Boyd headstone by HPNW in July 2019.

Contents

- Objectives 1
- Methodology 1
- Results..... 1
 - Misplaced Footstone Protocol 2
 - Misplaced Objects Protocol..... 2
- Recommendations 2
- Appendix A: Markers Treated..... 4
- Appendix B: Objects to Storage 5

Objectives

The objective of this project was to relevel, reset, and or repair all of the high- and medium-priority grave markers identified in the [2018 Brookside Preservation Plan](#). Historic Preservation Northwest (HPNW) was hired by the City of Dayton to carry out the work in June 2019. At the start of the project in July, the total was 91 markers. By the end of the project in September, the total was 121 markers.

Methodology

HPNW follows the Secretary of the Interior's Standards for the Treatment of Historic Resources. All interventions with grave markers were made starting with the gentlest means first. When any material needed to be replaced (such as new naturally hydraulic lime mortar for deteriorated lime mortar), the new, in-kind material matched in composition, design, color, texture, and all visual properties. Any substitute materials (such as Akepox 2010 epoxy to repair a thin, broken headstone), were used on a limited basis and only when the substitute materials would match the general properties of the historic material and would not damage the grave marker. Only gravel was used to level the grave markers; no concrete or cement was employed.

All work was done by David Pinyerd and Bernadette Niederer of HPNW. Both are graduates of the Historic Preservation master's degree program at the University of Oregon, 2000 and 2006, respectively. Both trained in cemetery preservation under the tutelage of Bruce Howard and Sally Donovan.

Results

The work on most of the 91 grave markers went as proposed in the initial survey from 2018; however, once one begins to dig, there are always surprises. For example, on the cover of this report is a grave marker where we thought the bottom portion of the headstone was missing; however, it had merely been buried over time. For the most part, the initial proposed treatments were accurate. We ended up using about 50lbs of natural hydraulic lime to reset stones and about 600 grams of Akepox 2010 epoxy to repair stones. We also used about three yards of gravel (provided by the City) to level grave markers.

We found 10 footstones buried, propping up monuments. Coupled with the 20 "loose footstones" scattered around the cemetery, the situation led us to take on an additional task of repatriating as many footstones as we could identify and taking the rest to off-site storage. This led to the increase from the original 91 markers to 121 markers that we dealt with. This is discussed in detail in the next section.

All work on the 121 grave markers was completed by HPNW in July-September 2019. Details on what we did to each marker, along with pictures of the process, are in [Appendix A](#).

Misplaced Footstone Protocol

We developed a protocol for handling misplaced footstones. Misplaced footstones are footstones that are lying loose in the cemetery and are not “set” in the ground. We began with 20 misplaced footstones and then uncovered an additional 10 footstones while releveling grave-stones.

If the misplaced footstone had no initials carved into it, then we recorded the stone’s provenience and took a photo. We labeled the bottom edge of the stone with an inventory number in soft pencil. The stone was then put in a paper bag, labeled with its inventory number and provenience, and put in off-site storage.

If the misplaced stone had initials carved into it, we consulted the alphabetic list of burials. If the initials matched a burial and there was no footstone associated with that burial, then we moved the footstone to the new location after carefully recording where the stone came from and where it was reset. Any repatriated footstones are noted and described in the database.

If the misplaced stone had initials, but there were multiple burials with the same initials, then we picked the most likely burial that matched in style and period. This situation only occurred in one instance.

If the burial location was within a curbed family plot, then we reset the footstone at the foot of the grave. If the burial location was outside of a curbed family plot, then we reset the footstone directly behind the gravestone to protect it.

If the misplaced stone had initials, but there was no burial that matched, then we labeled an edge in pencil, photographed, recorded in the database, and removed the footstone to the off-site storage.

See [Appendix B](#) for a list of 19 stone objects put into off-site storage. Each stone object has an object number in a “A99” format, where “A” distinguishes stone.

Misplaced Objects Protocol

While working in the cemetery, we found 10 items other than footstones that were “loose” in the cemetery. All of these items were metal and most were temporary grave markers that were lying flat on the ground. These objects were labeled in pencil, photographed, recorded in the database, and removed to off-site storage.

See [Appendix B](#) for a list of the objects put into off-site storage. Each metal object has an object number in a “B99” format, where “B” distinguishes metal.

Recommendations

After spending 20 days this summer working in the cemetery from one end to the other, we’ve observed a few things that we think should be next steps that are relatively easy to tackle:

1. Cut back the ivy. One stone (#20-11) has already started to disappear into the ivy again! Trimming it back now with clippers and uprooting what you can will be much easier than having to trim it with a chainsaw in a year or two.

2. Cut back the filbert suckers. Filberts are attempting to come back with a vengeance in two places.
3. We don't recommend cleaning stones very often but this cemetery needs a good cleaning. Methodically, row by row. We cleaned four stones and it was like night and day. Follow the cleaning method described in the Preservation Plan. We left the final step of cleaning on all but four of the 121 stones that we dealt with so there is plenty of embedded dirt and moss that is just itching to come off.
4. Clean up the non-organic trash. There are a lot of broken pieces of glass and plastic scattered throughout the cemetery, most of which are former flower holders. We saw nothing that needs to be kept that we didn't already move to off-site storage.
5. Clean up the organic trash. There are branches and roots scattered about the cemetery. We tossed our clippings over the south edge.
6. Pick up the piles of loose concrete and brick. We left several piles of broken up concrete and brick within family plots mostly along the south edge. Decide on a repository where they can be piled in case there are worries about throwing out something important. Basically, anything that isn't stone with a right angle edge can be tossed. Stone is pretty obvious versus concrete once you look at enough of it. There are many pieces of broken curbing that should also be removed. They only serve as water traps in many cases and cannot be reused for restoration.
7. Mount a "realtor box" to the new wooden sign post next to the information sign. Put a list of the burials in number order, a list of the burials in alphabetic order, and a map in the box for visitors to borrow when they visit. Put "Please Return" on the box and papers.
8. Fill some of the depressions and holes in the walking paths with gravel and dirt. Walking back and forth day after day we found the cemetery is quite uneven and there are legitimate trip hazards with some of the holes.

All of these items can be accomplished by volunteers. They are all great ways to build camaraderie and to build your volunteer base. Accomplishing these eight items will go a long way towards sprucing up the cemetery and keeping it under control.

Appendix A: Markers Treated

As part of the [Preservation Plan](#) HPNW wrote for the cemetery in 2018, an inventory record for each marker was created along with a map. This inventory included the treatment needs of each stone.

In June 2019, HPNW was hired by the City of Dayton to treat each of the markers flagged as needing high- or medium-priority treatment. A matching grant was awarded by State Historic Preservation Office (SHPO) through the City's Certified Local Government (CLG) program, and the work for each of those markers was done by HPNW in September-October 2019. This appendix records the work performed on each marker.

The report shows a planned treatment and an actual treatment with a date. The treatment date is the date treatment was started, as most stones took at least two visits to complete. The leftmost photo is the photo taken when the stone was initially inventoried in July 2018. The three adjacent photos are the photos taken during the treatment process, with the rightmost photo being a final photo of the stone. Photo file names are vertically oriented to the left of each photo. Each photo file name starts with a "99-99" label which corresponds to the stone's inventory number in the database.

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 01-02

Names: Nancy Adeline HUTCHENS C

Planned Treatment:

repair four old breaks and reset

Actual Treatment: 7/11/2019

reveled and epoxied (Akepox 2010) four breaks

01-02-IMG_6583



01-02-IMG_20190711_164108449



01-02-IMG_20190711_173541351



01-02-IMG_20190729_141940846



Marker: 01-04

Names: Leah Flossie KREITZ

Planned Treatment:

relevel only

Actual Treatment: 7/24/2019

reveled


01-04-IMG_6585



01-04-IMG_20190724_141211005



01-04-IMG_20190724_144515920

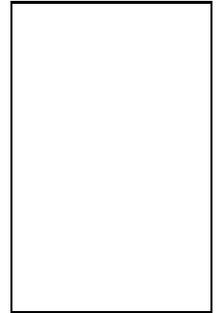

Marker: 01-06

Names: Catharine KREITZ

Planned Treatment:

relevel only

Actual Treatment: 7/24/2019

reveled

01-06-IMG_6587



01-06-IMG_20190724_151601232



01-06-IMG_20190724_152806290



01-06-IMG_20190724_154412108



Marker: 01-16

Names: James W COLLINS

Planned Treatment:

relevel only

Actual Treatment: 7/22/2019

reveled


01-16-IMG_6599



01-16-IMG_20190722_165227050



01-16-IMG_20190722_171540063

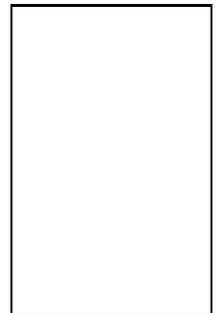

Marker: 01-23

Names: George SAGER

Planned Treatment:

repair chip, clean after repair

Actual Treatment: 7/22/2019

reveled and epoxied (Akepox 2010) chip around pin; footstone "G.S." set in soil behind headstone

01-23-IMG_6606



01-23-IMG_20190722_153917837



01-23-IMG_20190722_153937758



01-23-IMG_20190812_143316527



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 02-02

Names: William Macy HADLEY

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

reset "W.M.H." footstone found at 08-05 in soil behind stone


02-02-IMG_6609



02-02-IMG_20190904_152126590



02-02-IMG_20190904_153158895

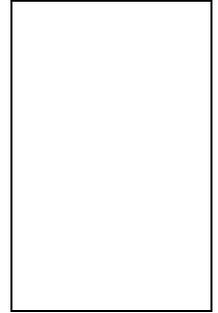

Marker: 02-04

Names: Mary Alice MOORE VANDEC

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/4/2019

footstones A01, A02, A03 moved to offsite storage; "E.E." footstone moved to 09-26; reset "M.A.V." footstone


02-04-IMG_6611



02-04-IMG_20190904_110938455



02-04-IMG_20190904_111703377

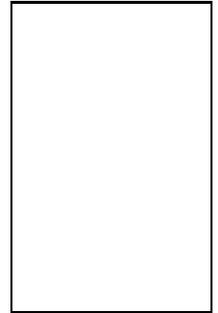

Marker: 02-05

Names: Elizabeth MOORE

Planned Treatment:

relevel, repair and reset

Actual Treatment: 7/22/2019

epoxied (Akepox 2010) two breaks

02-05-IMG_6612



02-05-IMG_20190722_122842223



02-05-IMG_20190722_153734048



02-05-IMG_20190812_144420763



Marker: 02-06

Names: William MOORE

Planned Treatment:

relevel, repair and reset

Actual Treatment: 7/22/2019

releveled and epoxied (Akepox 2010) three breaks

02-06-IMG_6613



02-06-IMG_20190722_152906877



02-06-IMG_20190729_143257623



02-06-IMG_20190819_173445210



Marker: 03-01

Names: Emily YEO

Planned Treatment:

relevel and reset stone, clean only after issues resolved

Actual Treatment: 7/5/2019

releveled and reset stone with lime mortar

03-01-IMG_6615



03-01-IMG_20190711_155627268



03-01-IMG_20190711_162755571



03-01-IMG_20190711_162950347



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 03-36

Names: David IRA?

Planned Treatment:

relevel, repair and reset



Actual Treatment: 9/4/2019

fragment A04 moved to offsite storage

03-36-IMG_6650



03-36-IMG_20190904_113834989

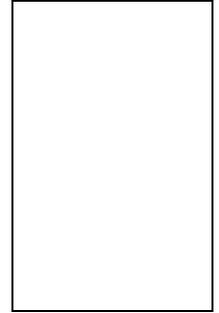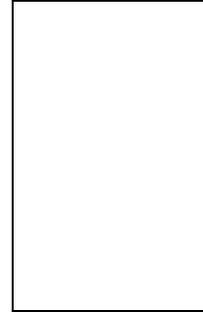

Marker: 03-37

Names: Gracie EARL

Planned Treatment:

relevel only

Actual Treatment: 7/29/2019

reveled


03-37-IMG_6651



03-37-IMG_20190729_110447608



03-37-IMG_20190729_112907902

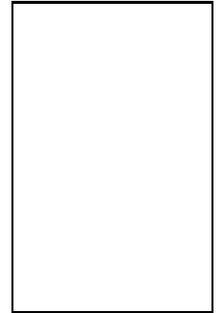

Marker: 04-13

Names: Freddie HELM

Planned Treatment:

relevel, repair and reset; clean after repair

Actual Treatment: 7/29/2019

leveled and epoxied (Akepox 2010) break

04-13-IMG_6664



04-13-IMG_20190729_121755060



04-13-IMG_20190729_123611662



04-13-IMG_20190812_145150120



Marker: 04-17

Names: Adaline SMITH

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

"A.S." footstone from 06-34 reset in soil behind stone

04-17-IMG_6668



04-17-IMG_20190904_143342804



04-17-IMG_20190904_143733273



04-17-IMG_20190904_144031173



Marker: 04-20

Names: Andrew D SMITH

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

"A.D.S." footstone from 06-35 reset in soil behind stone


04-20-IMG_6671



04-20-IMG_20190904_143353521



04-20-IMG_20190904_144555240

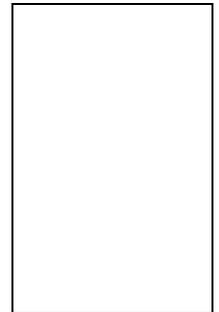

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 05-02

Names: Mattie H ROBINSON

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 7/24/2019

reset stone with epoxy and trimmed with lime mortar

05-02-IMG_6678



05-02-IMG_20190724_135430327



05-02-IMG_20190808_172245113



05-02-IMG_20190812_162821196



Marker: 05-03

Names: Mary Alice HILL

Planned Treatment:

repair and reset

Actual Treatment: 7/5/2019

raised and releveled and epoxied (AkepoX 2010) two breaks

05-03-IMG_6679



05-03-IMG_20190705_1155439576



05-03-IMG_20190705_164952681



05-03-IMG_20190724_134427785



Marker: 05-06

Names: Ernest MORSE

Planned Treatment:

do not clean until relevel and reset complete

Actual Treatment: 7/15/2019

releveled and reset stone with lime mortar; cleaned with water

05-06-IMG_6682



05-06-IMG_20190715_120451091



05-06-IMG_20190715_131746971



05-06-IMG_20190724_140359645



Marker: 05-20

Names: Rosella J HUDDLESTON HA

Planned Treatment:

raise stone and level

Actual Treatment: 9/12/2019

"R.J." footstone from 05-23 reset in soil behind stone


05-20-IMG_6696



05-20-IMG_20190912_110015527



05-20-IMG_20190912_111405172

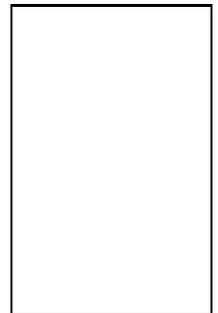

Marker: 05-21

Names: William T HASH?

Planned Treatment:

raise stone and level

Actual Treatment: 9/12/2019

"W.T.H." footstone from 5-23 reset in soil behind stone


05-21-IMG_6697



05-21-IMG_20190912_110146728



05-21-IMG_20190912_111647130

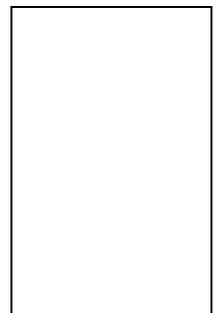

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 05-23

Names: "R.J."




Planned Treatment:

reset only

Actual Treatment: 9/12/2019

"R.J." footstone moved to 05-20
Nearby "W.T.H." footstone moved to 05-21

05-23-IMG_6699

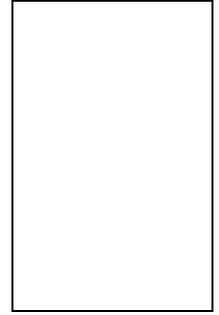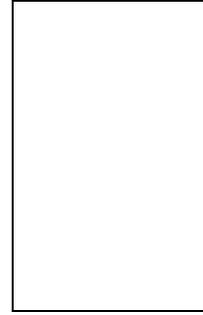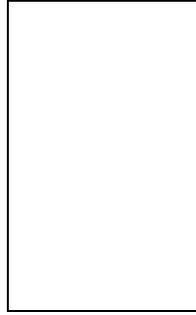

Marker: 06-01

Names: Carl S SEITTERS


Planned Treatment:

relevel and reset

Actual Treatment: 9/4/2019

headstone reset by others; leveled;
"C.S.S." footstone reset in soil behind stone

06-01-IMG_6702

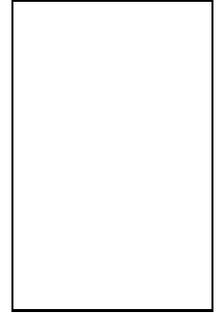

Marker: 06-05

Names: Ida M ARMSTRONG

Planned Treatment:

relevel, reset and repair

Actual Treatment: 7/5/2019

releveled and reset with epoxy

06-05-IMG_6706



Marker: 06-12

Names: Chesman D HOWARD

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

"C.D.H." footstone from 07-08 reset in soil at foot

06-12-IMG_6713



Marker: 06-17

Names: Baby Boy COURTNEY

Planned Treatment:

clean after relevel and reset

Actual Treatment: 8/2/2019

releveled and reset with lime mortar

06-17-IMG_6718



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 06-18

Names: "E.E.D."

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/4/2019

"E.E.D." footstone reset in soil behind 06-21

06-18-IMG_6719



06-18-IMG_20190904_115539675



06-18-IMG_20190904_115555483



06-18-IMG_20190904_115915466



Marker: 06-19

Names: John F TAYLOR

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 7/22/2019

reveled, cleared slot, epoxied (Akepox 2010) fragment, lime mortared slot, epoxied top piece; footstone "J.T.F" placed behind headstone; "J.A." footstone moved to 24-04; A05 and A06 to offsite storage

06-19-IMG_6720



06-19-IMG_20190722_104946041



06-19-IMG_20190812_150308416



06-19-IMG_20190812_150953112



Marker: 06-21

Names: Ella E TAYLOR DETMERING

Planned Treatment:

remove filbert; no treatment needed other than cleaning



Actual Treatment: 9/4/2019

fragment A07 moved to offsite storage

06-21-IMG_6722



A07-IMG_20190904_121221802

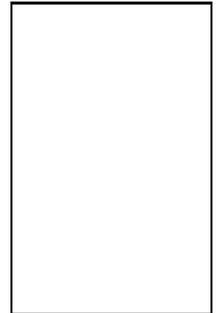

Marker: 06-22

Names: Christopher TAYLOR

Planned Treatment:

light cleaning only, the black is a patina that will not come off with any approved

Actual Treatment: 9/4/2019

found footstone base, raised, "C.T." footstone set in lime mortar

06-22-IMG_6723



06-22-IMG_20190904_124155090



06-22-IMG_20190904_150712568



06-22-IMG_20190912_110557329



Marker: 06-23

Names: Sarah A WILLIAMS TAYLOR

Planned Treatment:

light cleaning only, the black is a patina that will not come off with any approved

Actual Treatment: 7/29/2019

reveled; "S.A.T." footstone placed in ground behind base

06-23-IMG_6724



06-23-IMG_20190729_114142191



06-23-IMG_20190729_115419052



06-23-IMG_20190904_142123890



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 06-29

Names: William E. GIBBS & Martin E

Planned Treatment:

could not relevel base due to concrete mass so set stone behind base Sept 2017

Actual Treatment: 9/12/2019

could not relevel base due to concrete mass so set stone behind base Sept 2017; tried again in Sept 2019, still too heavy, turned headstone so more readable

06-29-IMG_6730



06-29-IMG_6055



06-29-IMG_6298



06-29-IMG_20190912_170432650



Marker: 06-32

Names: "MOTHER"

Planned Treatment:

relevel only

Actual Treatment: 8/24/2019

reveled and reset in lime mortar; concrete over sandstone failing

06-32-IMG_6733



06-32-IMG_20190824_135036117



06-32-IMG_20190824_140309414



06-32-IMG_20190824_141432260



Marker: 06-34

Names: "A.S."




Planned Treatment:

reset only

Actual Treatment: 9/4/2019

"A.S." footstone moved to 04-17

06-34-IMG_6735

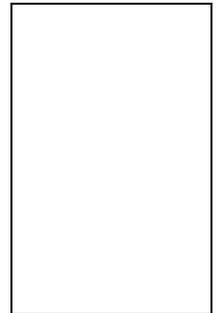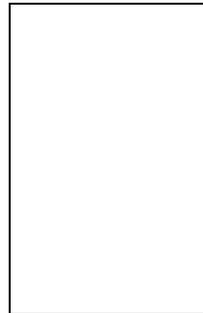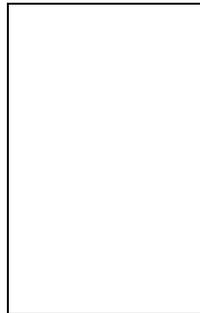

Marker: 06-35

Names: "A.D.S."

Planned Treatment:

reset only

Actual Treatment: 9/4/2019

"A.D.S." footstone moved to 04-20; fragment A08 moved to offsite storage


06-35-IMG_6736



06-35-IMG_20190904_142301145



A08-IMG_20190904_144757754

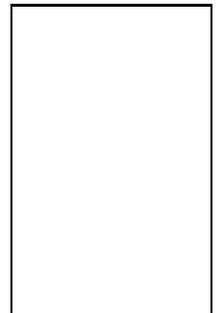

Marker: 07-07

Names: Fern Marie MCCANN

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

"F.M.McC" footstone from 08-02 reset in soil

07-07-IMG_6747



07-07-IMG_20190904_153414273



07-07-IMG_20190904_153721882



07-07-IMG_20190904_153937641



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 07-08

Names: Artcher McDONALD




Planned Treatment:

monitor lean, relevel when ~10 degree inclination reached; see Preservation

Actual Treatment: 9/4/2019

"C.D.H." footstone moved to 06-12

07-08-IMG_6748

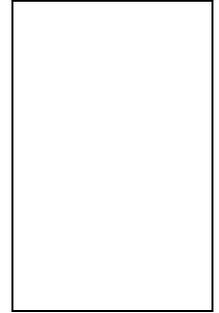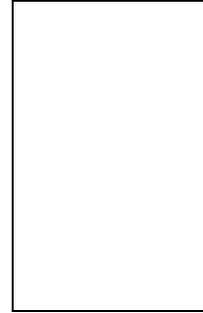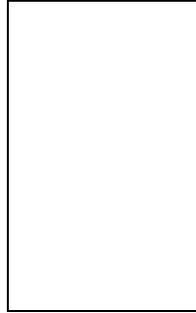

Marker: 07-09

Names: W. G SHEARD

Planned Treatment:

move gravestone within plot but out of way of cedar; fully document move; level

Actual Treatment: 8/12/2019

moved base three feet to the south to separate from cedar, relevelled, and reset with epoxy (Akepox 2010)

07-09-IMG_6749



07-09-IMG_20190812_123105414



07-09-IMG_20190812_131813727



07-09-IMG_20190812_133631345



Marker: 08-02

Names: Regnald E DUPUY

Planned Treatment:

relevel, repair and reset

Actual Treatment: 7/5/2019

relevelled and epoxied (Akepox 2010) two breaks; found "F.M.McC" footstone and reset at 07-07

08-02-IMG_6768



08-02-IMG_20190705_143542935



08-02-IMG_20190705_144332390



08-02-IMG_20190724_102708324



Marker: 08-05

Names: "W.M.H."




Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/4/2019

"W.M.H." footstone moved to 02-02

08-05-IMG_6771

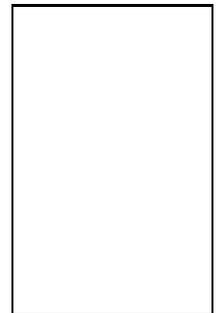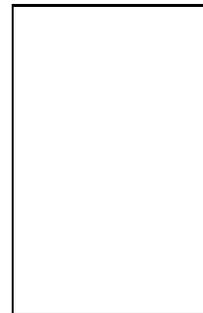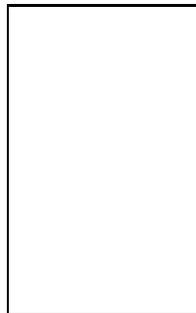

Marker: 08-11

Names: Harry Moore COFFIN

Planned Treatment:

no treatment needed other than cleaning



Actual Treatment: 9/4/2019

"O.R.P." footstone moved to 10-04; A09a and A09b fragments moved to offsite storage

08-11-IMG_6777



08-11-IMG_20190904_154648733

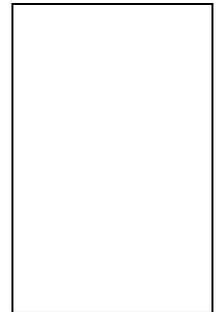

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 08-16

Names: "P.E."?

Planned Treatment:

see Preservation Plan for dislocated footstone protocol



Actual Treatment: 9/4/2019

A10a, A10b, A10c fragments moved to offsite storage

08-16-IMG_6782



08-16-IMG_20190904_155702937

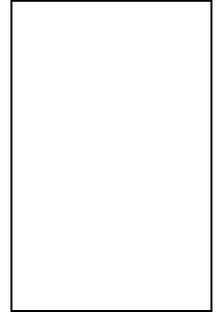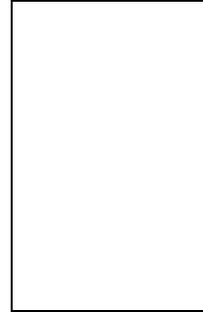

Marker: 08-18

Names: Leone FREEMAN MARTIN

Planned Treatment:

relevel only

Actual Treatment: 7/5/2019

releveled


08-18-IMG_6784



08-18-IMG_20190705_115615125



08-18-IMG_20190705_120302177

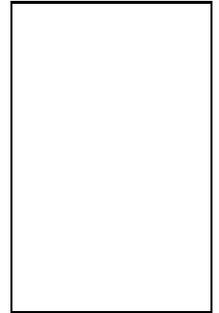

Marker: 08-20

Names: Ipha E ROBBINS

Planned Treatment:

relevel and reset

Actual Treatment: 7/5/2019

releveled, reset with epoxy, and trimmed with lime mortar

08-20-IMG_6786



08-20-IMG_20190705_122007962



08-20-IMG_20190705_124452995



08-20-IMG_20190812_152356498



Marker: 08-23

Names: Emma C OVERHOLTZER

Planned Treatment:

monitor lean, relevel when ~10 degree inclination reached

Actual Treatment: 9/12/2019

"E.C.O." footstone from 15-19 repaired with epoxy (Akepox 2010) and reset in soil behind base

08-23-IMG_6789



08-23-IMG_20190912_133358412



08-23-IMG_20190912_133415653



08-23-IMG_20190912_134840290



Marker: 08-26

Names: Lena CROSBY

Planned Treatment:

see Wood Markers in Preservation Plan for treatment; basically move off-site and

Actual Treatment: 7/29/2019

removed to shop for restoration; removed wire nails; repaired with 1-1/2" air-driven finish nails, no glue; reinstalled with two nails per side near bottom into concrete base

08-26-IMG_20190809_120008933



08-26-IMG_20190729_151629713



08-26-IMG_20190810_110601606



08-26-IMG_20190812_104817068



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 08-27

Names: W H BURKE

Planned Treatment:
relevel only

Actual Treatment: 8/24/2019
reveled to match 08-28


08-27-IMG_6793



08-27-IMG_20190824_133839876



08-27-IMG_20190824_134026682

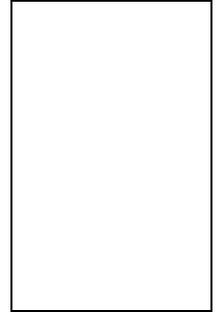

Marker: 08-28

Names: D W BURKE

Planned Treatment:
relevel only

Actual Treatment: 8/24/2019
reveled to match 08-27


08-28-IMG_6794



08-28-IMG_20190824_133024292



08-28-IMG_20190824_133626757

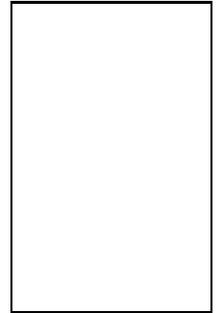

Marker: 09-01

Names: M (N?) Ellinor TROWBRIDGE

Planned Treatment:
investigate if repair is possible

Actual Treatment: 7/15/2019
reveled and epoxied (Akepox 2010) four breaks; found "C.S.S." footstone and moved to 06-01

09-01-IMG_6795



09-01-IMG_20190715_150954381



09-01-IMG_20190715_152726736



09-01-IMG_20190724_102507073



Marker: 09-19

Names: Virginia Ann ADKINS KIRK

Planned Treatment:
relevel only

Actual Treatment: 7/5/2019
reveled

09-19-IMG_6813



09-19-IMG_20190705_105208809



09-19-IMG_20190705_110848934



09-19-IMG_20190705_112331880






Marker: 09-21

Names: "W.H."

Planned Treatment:
research relocation; see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/4/2019
A11 "W.H." footstone moved to offsite storage

09-21-IMG_6815

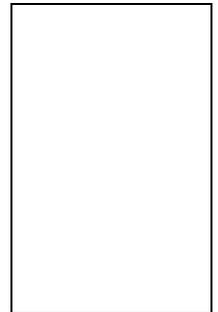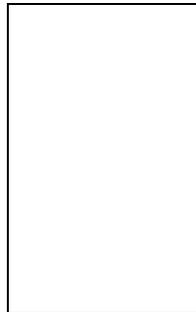

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 09-26

Names: Emma Mabel EARL

Planned Treatment:

excavate to see whether base exists

Actual Treatment: 7/29/2019

sandstone base completely decayed, cast new base in concrete, lime mortared slot; footstone "E.E." from 02-04 reset in soil behind new base

09-26-IMG_6820



09-26-IMG_20190729_154742983



09-26-IMG_20190808_112013662



09-26-IMG_20190812_152245116



Marker: 10-04

Names: Orbon Robert PEERY

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/4/2019

"O.R.P." footstone from 08-11 reset in soil behind stone


10-04-IMG_6826



10-04-IMG_20190904_155023880



10-04-IMG_20190904_155401685

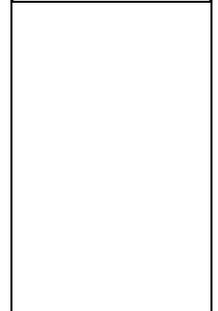

Marker: 10-09

Names: Eleanor G CHRISMAN DARR


Planned Treatment:

reset only

Actual Treatment: 8/24/2019

recentered on base, no mortar


10-09-IMG_6831

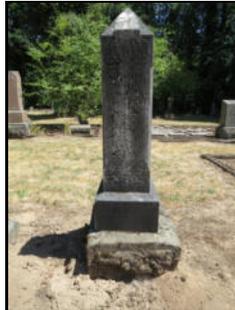

10-09-IMG_20190824_105719247



10-09-IMG_20190824_111309743

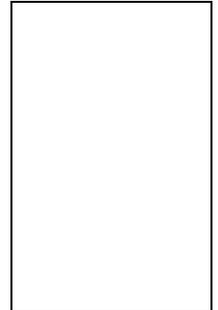

Marker: 10-14

Names: Dorothy T POOLE & Edward

Planned Treatment:

relevel only

Actual Treatment: 7/19/2019

reveled; "D.T.P." footstone reset in soil behind base

10-14-IMG_6836



10-14-IMG_20190719_110408303



10-14-IMG_20190719_111912308



10-14-IMG_20190904_163645951



Marker: 10-15

Names: Elvira MCGINNIS

Planned Treatment:

relevel only

Actual Treatment: 7/19/2019

reveled and reset in epoxy

10-15-IMG_6837



10-15-IMG_20190719_1153643654



10-15-IMG_20190719_160032866



10-15-IMG_20190719_161601311



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 10-16

Names: S A MCGINNIS?

Planned Treatment:

clean base; no treatment until headstone found

Actual Treatment: 7/29/2019

probed around base, found nothing in addition to base with mortar area 8"x18"


10-16-IMG_6838



10-16-IMG_20190729_155309776



10-16-IMG_20190729_155624210

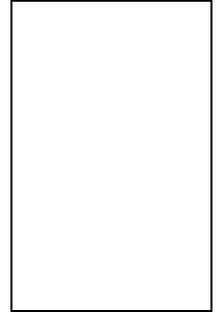

Marker: 11-02

Names: "F.A.B."




Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/4/2019

"F.A.B." footstone moved to 15-04; base left with missing headstone

11-02-IMG_6840

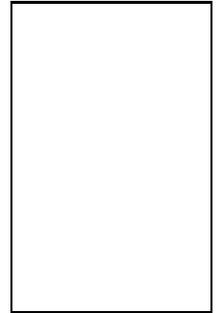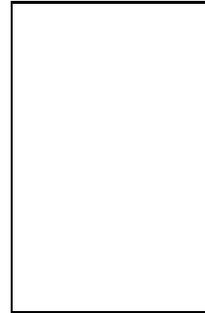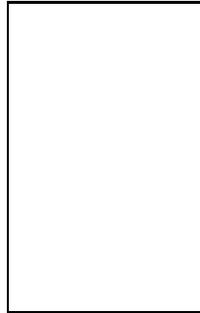

Marker: 11-18

Names: Mary GRAHAM

Planned Treatment:

relevel only

Actual Treatment: 7/19/2019

reveled

11-18-IMG_6856



11-18-IMG_20190719_112014005



11-18-IMG_20190719_114140785



11-18-IMG_20190719_114833137



Marker: 11-19

Names: William GRAHAM

Planned Treatment:

relevel, repair and reset; see Preservation Plan for dislocated footstone protocol

Actual Treatment: 7/19/2019

raised base, relevelled, epoxied (Akepox 2010) two breaks; footstone "Wm.G." reset in soil behind base; "G.S." footstone A12 moved to offsite storage

11-19-IMG_6857



11-19-IMG_20190719_115852567



11-19-IMG_20190719_125013427



11-19-IMG_20190808_172741638



Marker: 11-21

Names: Emma STARR & Dillie STAR

Planned Treatment:

see Preservation Plan for dislocated footstone protocol



Actual Treatment: 9/4/2019

blank footstone A13 moved to offsite storage

11-21-IMG_6859



A13-IMG_20190904_170843579

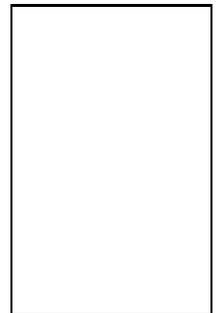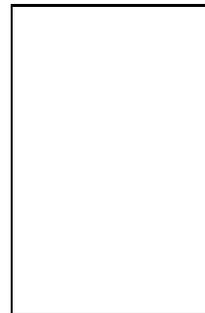

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 11-22

Names: "DILLIE"

Planned Treatment:

relevel and reset

Actual Treatment: 8/24/2019

reveled

11-22-IMG_6860



11-22-IMG_20190824_120531927



11-22-IMG_20190824_121754290



11-22-IMG_20190824_121806223



Marker: 12-01

Names: Lillie LAPORT

Planned Treatment:

examine pins, remove and reset

Actual Treatment: 8/12/2019

reveled and reset in lime mortar; moved metal auxiliary marker to front of stone

12-01-IMG_6863



12-01-IMG_20190812_165752942



12-01-IMG_20190812_171111370



12-01-IMG_20190815_170548345



Marker: 12-04

Names: Julius B GARDNER

Planned Treatment:

relevel only

Actual Treatment: 8/19/2019

reveled

12-04-IMG_6866



12-04-IMG_20190819_105625945



12-04-IMG_20190819_110914858



12-04-IMG_20190819_111831160



Marker: 12-07

Names: Luther J FLETCHER

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

"L.J.F." footstone reset in soil behind stone


12-07-IMG_6869



12-07-IMG_20190912_115213321



12-07-IMG_20190912_115837060

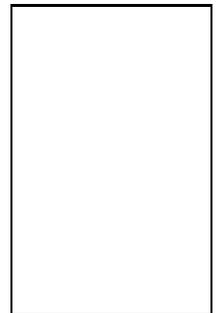

Marker: 12-11

Names: Sarah An SKELTON & Georg

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

"S.A.S." footstone reset in soil behind stone; A14a-g fragments moved to offsite storage

12-11-IMG_6873



12-11-IMG_20190912_114229068



A14-IMG_20190912_111856509



A14-IMG_20190912_113317180



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 12-14

Names: Adria M HASH PHELPS & No

Planned Treatment:

reattach urn before cleaning

Actual Treatment: 7/15/2019

reveled stone and reset urn with lime mortar

12-14-IMG_6876



12-14-IMG_20190715_124019937



12-14-IMG_20190715_130911241



12-14-IMG_20190719_103200380



Marker: 12-15

Names: "N.P."

Planned Treatment:

epoxy break

Actual Treatment: 8/12/2019

epoxied (Akepox 2010) break

12-15-IMG_6877



12-15-IMG_20190812_152610842



12-15-IMG_20190812_153414167



12-15-IMG_20190819_173641955



Marker: 12-16

Names: George A HASH

Planned Treatment:

relevel only

Actual Treatment: 7/29/2019

reveled


12-16-IMG_6878



12-16-IMG_20190729_161529514



12-16-IMG_20190729_161954301

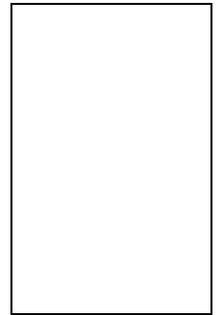

Marker: 13-01

Names: Paul BOYCE

Planned Treatment:

relevel only

Actual Treatment: 7/7/2019

reveled; reset "P.B." footstone from 13-19 in soil behind base

13-01-IMG_6879



13-01-IMG_20190707_120058276



13-01-IMG_20190707_121911764



13-01-IMG_20190912_115124453



Marker: 13-03

Names: Robert E DOUGLAS

Planned Treatment:

relevel and reset

Actual Treatment: 7/7/2019

reveled and centered


13-03-IMG_6881



13-03-IMG_20190707_114152234



13-03-IMG_20190707_115621572

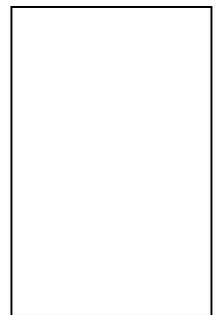

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 13-04

Names: Edward STRUNK


Planned Treatment:

reset only

Actual Treatment: 8/2/2019

reset in lime mortar

13-04-IMG_6882

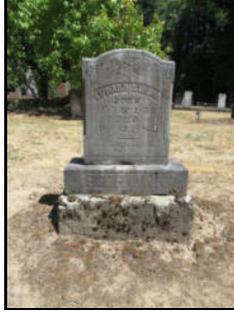

13-04-IMG_20190802_14824327



13-04-IMG_20190802_125412429



13-04-IMG_20190808_163507686



Marker: 13-12

Names: Mary PERRY

Planned Treatment:

cut out mulberry and releve

Actual Treatment: 8/8/2019

releveled

13-12-IMG_6890



13-12-IMG_20190808_161254496



13-12-IMG_20190808_162848019



13-12-IMG_20190808_163149217



Marker: 13-13

Names: Elizabeth NICHOLS

Planned Treatment:

cut out mulberry and releve

Actual Treatment: 7/7/2019

releveled


13-13-IMG_6891



13-13-IMG_20190707_105728845



13-13-IMG_20190707_113805625

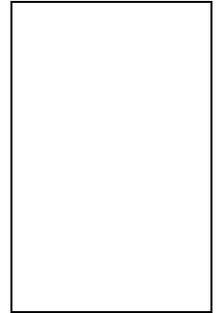

Marker: 13-14

Names: Rena V NICHOLS

Planned Treatment:

relevel and reset

Actual Treatment: 7/1/2019

releveled and reset with epoxy

13-14-IMG_6892



13-14-IMG_20190701_122041383



13-14-IMG_20190701_124207695



13-14-IMG_20190701_125658645



Marker: 13-15

Names: "R.V.N."

Planned Treatment:

relevel and reset

Actual Treatment: 8/8/2019

releveled and reset in epoxy; restored marble curbing

13-15-IMG_6893



13-15-IMG_20190808_150043671



13-15-IMG_20190808_150323910



13-15-IMG_20190808_155948083



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 13-16

Names: Isidore NICHOLS

Planned Treatment:

relevel and reset

Actual Treatment: 7/1/2019

reveled and lime mortared pin gap

13-16-IMG_6894



13-16-IMG_20190701_113333077



13-16-IMG_20190701_122553321



13-16-IMG_20190802_122801191



Marker: 13-19

Names: Elizabeth MOORE

Planned Treatment:

relevel; see Preservation Plan for dislocated footstone protocol

Actual Treatment: 8/24/2019

reveled; moved "P.B." footstone to 13-01

13-19-IMG_6897



13-19-IMG_20190824_111413394



13-19-IMG_20190824_112143610



13-19-IMG_20190824_115728385



Marker: 13-20

Names: William CAIN

Planned Treatment:

relevel and reset

Actual Treatment: 7/7/2019

reveled and reset with epoxy

13-20-IMG_6898



13-20-IMG_20190707_162056444



13-20-IMG_20190707_163758382



13-20-IMG_20190729_150424275



Marker: 13-26

Names: William CAIN?

Planned Treatment:

no treatment needed other than cleaning

Actual Treatment: 9/12/2019

A15 footstone found and moved to offsite storage


13-26-IMG_6904



A15-IMG_20190912_120004311



A15-IMG_20190912_120136673

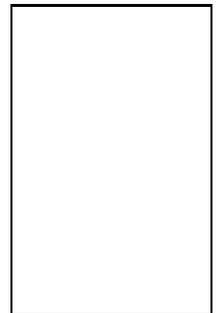

Marker: 14-05

Names: John WILSON & Triphena WI

Planned Treatment:

investigate broken concrete at base, base might not need repair

Actual Treatment: 9/12/2019

"J.W." footstone from 14-07 reset in soil at foot of 14-05; "T.W." footstone from 14-08 reset in soil at foot of 14-05 (right); "L.T.W." footstone from 14-09 reset in soil at foot of 14-05 (left)

14-05-IMG_6910



14-05-IMG_20190912_122354233



14-05-IMG_20190912_122401019



14-05-IMG_20190912_121506243



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 14-07

Names: "J.W."




Planned Treatment:

reset only

Actual Treatment: 9/12/2019

"J.W." footstone reset in soil at foot of 14-05

14-07-IMG_6912

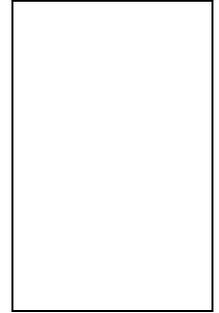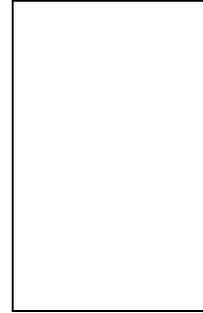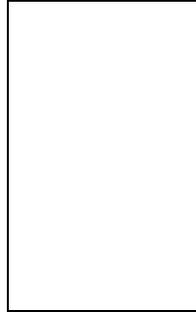

Marker: 14-08

Names: "T.W."




Planned Treatment:

reset only

Actual Treatment: 9/12/2019

"T.W." footstone reset in soil at foot of 14-05 (right)

14-08-IMG_6913

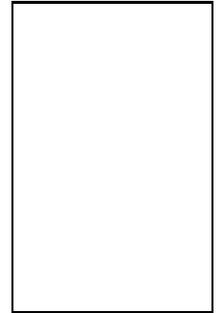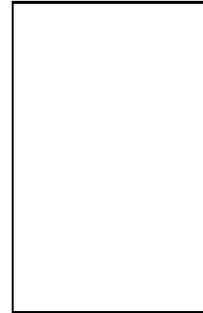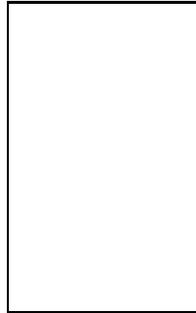

Marker: 14-09

Names: "L.T.W."

Planned Treatment:

reset only



Actual Treatment: 9/12/2019

"L.T.W." footstone reset in soil at foot of 14-05 (left)

14-09-IMG_6914



14-09-IMG_20190912_120846733

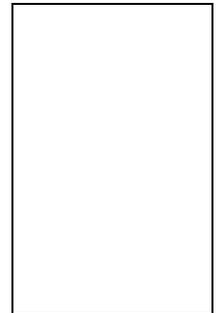

Marker: 14-13

Names: Richard MORGAREIDGE

Planned Treatment:

releveled Sept 2017

Actual Treatment: 8/2/2019

releveled stone Sept 2017; dismantled one pipe rail, inserted new used pipe, and epoxied cast stud; dug out SE and NE corner posts and reset in gravel

14-13-IMG_6918



14-13-IMG_20190719_150128550



14-13-IMG_20190730_121731749



14-13-IMG_20190812_112334037



Marker: 14-14

Names: Lloyd G MORGAREIDGE

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

blank footstone left in place


14-14-IMG_6919



14-14-IMG_20190912_135249894



14-14-IMG_20190912_135534088

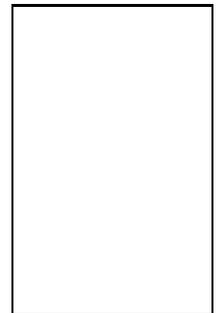

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 15-01

Names: Genevieve CRAWFORD

Planned Treatment:

reset only

Actual Treatment: 8/24/2019

reset in epoxy

15-01-IMG_6932



15-01-IMG_20190824_104132187



15-01-IMG_20190824_105023998



15-01-IMG_20190824_111502834



Marker: 15-04

Names: Francis A BOYD

Planned Treatment:

relevel, repair and reset

Actual Treatment: 7/2/2019

dug up base, set upright, epoxied (Akepox 2010) two breaks; footstone "F.A.B." from 11-02 reset in soil in front of base

15-04-IMG_6935



15-04-IMG_20190702_154205289



15-04-IMG_20190702_165559386



15-04-IMG_20190719_102516841



Marker: 15-19

Names: "E.C.O."

Planned Treatment:

epoxy break; see Preservation Plan for dislocated footstone protocol



Actual Treatment: 9/12/2019

"E.C.O." footstone moved to 08-23

15-19-IMG_6950



15-19-IMG_20190912_133014801

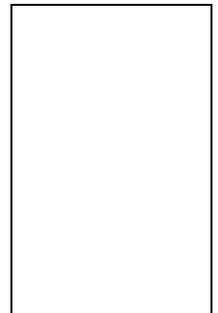

Marker: 15-20

Names: Charles E HADLEY

Planned Treatment:

remove holly, relevel, repair and reset

Actual Treatment: 7/2/2019

reveled and epoxied (Akepox 2010) three breaks

15-20-IMG_6951



15-20-IMG_20190702_135640316



15-20-IMG_20190709_161922989



15-20-IMG_20190719_102730522



Marker: 15-21

Names: Nelson H HADLEY

Planned Treatment:

remove holly; relevel, repair and reset

Actual Treatment: 7/2/2019

repositioned 6" from stump, reveled and epoxied (Akepox 2010) three breaks

15-21-IMG_6952



15-21-IMG_20190702_123306141



15-21-IMG_20190709_123759159



15-21-IMG_20190719_102754771



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 15-25

Names: Ida BURCH

Planned Treatment:

examine base, base may need to be replaced, or simply reshift shaft on

Actual Treatment: 7/2/2019

recentered shaft on base; eventually it will need new sandstone base


15-25-IMG_6956



15-25-IMG_20190702_151753481



15-25-IMG_20190702_152404569

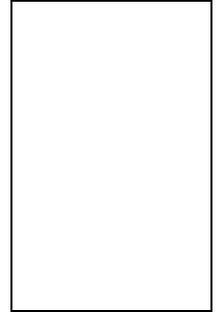

Marker: 16-15

Names: Margaret MANNING

Planned Treatment:

relevel and reset

Actual Treatment: 7/7/2019

releveled and reset in lime mortar; cleaned stone with water

16-15-IMG_6973



16-15-IMG_20190707_142533100



16-15-IMG_20190707_152248084



16-15-IMG_20190724_114250032



Marker: 16-19

Names: Kate FISCHER

Planned Treatment:

clean, relevel, and reset

Actual Treatment: 8/19/2019

releveled and reset in epoxy; found "C.L.F." footstone and reset at 16-20

16-19-IMG_6977



16-19-IMG_20190819_145823696



16-19-IMG_20190819_165200353



16-19-IMG_20190819_171931646



Marker: 16-20

Names: Carl FISCHER




Planned Treatment:

examine, could be raised out of dirt several inches

Actual Treatment: 9/12/2019

footstone "C.L.F." from 06-19 set in soil

16-20-IMG_6978

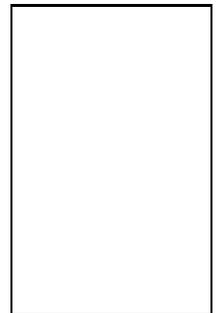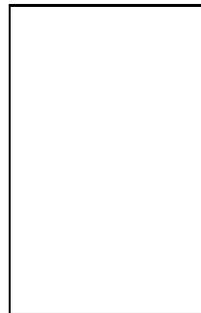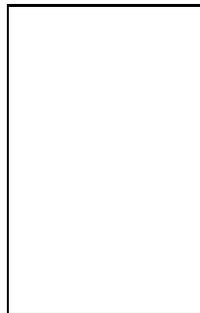

Marker: 16-21

Names: Blank

Planned Treatment:

apply footstone protocol and reset

Actual Treatment: 8/24/2019

blank footstone reset at foot of 16-22 for symmetry


16-21-IMG_6979



16-21-IMG_20190824_164754157



16-21-IMG_20190912_140333766

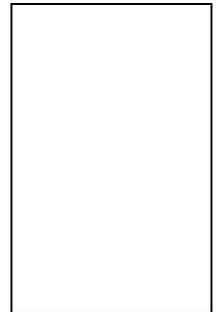

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 16-22

Names: "MOTHER"

Planned Treatment:

reset only

Actual Treatment: 9/12/2019

raised stone


16-22-IMG_6980



16-22-IMG_20190912_140354141



16-22-IMG_20190912_141101620

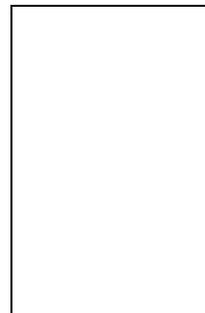

Marker: 17-06

Names: Jane H HADLEY GIBBON?

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

reset in place in soil

17-06-IMG_6987



17-06-IMG_20190912_141222506



17-06-IMG_20190912_141754022_H



Marker: 17-09

Names: Bessie B GIBBON

Planned Treatment:

relevel and reset

Actual Treatment: 8/19/2019

reveled and reset in lime mortar

17-09-IMG_6990



17-09-IMG_20190819_114146591



17-09-IMG_20190819_123305517



17-09-IMG_20190824_155518875



Marker: 17-18

Names: Lewis FENTON

Planned Treatment:

relevel only

Actual Treatment: 7/7/2019

reveled

17-18-IMG_6999



17-18-IMG_20190707_155122602



17-18-IMG_20190707_160753963



17-18-IMG_20190707_161305564



Marker: 18-01

Names: Clark ILER

Planned Treatment:

relevel base; see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

"B.D." footstone moved to 22-04

18-01-IMG_7000



18-01-IMG_20190912_142104959_H



18-01-IMG_20190912_142115177_H



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 19-06

Names: "MOTHER"

Planned Treatment:

reset only

Actual Treatment: 8/24/2019

reset in soil


19-06-IMG_7013



19-06-IMG_20190824_155657429



19-06-IMG_20190824_160841223

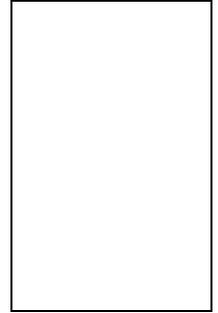

Marker: 19-07

Names: Ransom M WOOLWORTH &

Planned Treatment:

monitor lean, relevel when ~10 degree inclination reached

Actual Treatment: 9/12/2019

footstone fragment "?G.H." A17 moved to offsite storage


19-07-IMG_7014



A17-IMG_20190912_143044433



A17-IMG_20190912_143124602

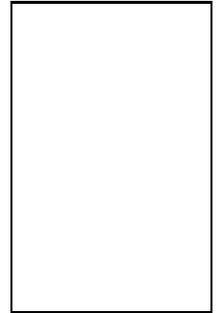

Marker: 19-08

Names: "G.D.S."

Planned Treatment:

reset only

Actual Treatment: 8/24/2019

reset in soil

19-08-IMG_7034



19-08-IMG_20190824_155644581



19-08-IMG_20190824_155924106



19-08-IMG_20190824_160810654



Marker: 19-09

Names: "MOTHER"




Planned Treatment:

relevel base and reset

Actual Treatment: 9/4/2019

concrete base does not appear to go with "MOTHER" granite stone, left where found

19-09-IMG_7015

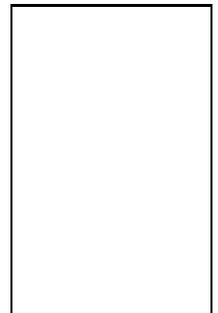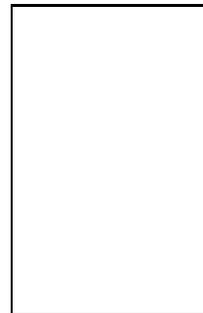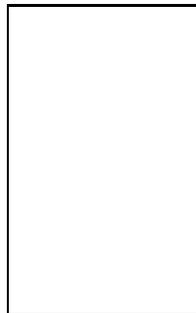

Marker: 19-12

Names: Debra MONROE ROBERTSO

Planned Treatment:

relevel and reset

Actual Treatment: 8/24/2019

reveled and reset in epoxy


19-12-IMG_7018



19-12-IMG_20190824_152025511



19-12-IMG_20190824_153937286

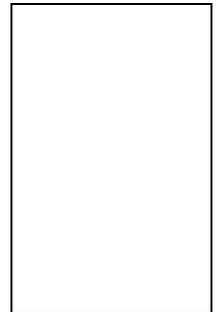

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 19-13

Names: Charles C EISELE

Planned Treatment:

reset only

Actual Treatment: 7/24/2019

relevelled base, shortened pins, and reset in lime mortar

19-13-IMG_7019



19-13-IMG_20190724_164403056



19-13-IMG_20190802_172512066



19-13-IMG_20190808_164023077



Marker: 19-14

Names: Mable F EISELE

Planned Treatment:

relevel only

Actual Treatment: 7/24/2019

relevelled

19-14-IMG_7020



19-14-IMG_20190724_165013438



19-14-IMG_20190724_170345446



19-14-IMG_20190724_170748645



Marker: 19-18

Names: John R LITELL & Susan E LIT

Planned Treatment:

relevel and reset

Actual Treatment: 8/15/2019

relevelled and reset in lime mortar

19-18-IMG_7024



19-18-IMG_20190815_161927693



19-18-IMG_20190815_165207528



19-18-IMG_20190819_151443976



Marker: 20-01

Names: Verna CROFUT LOWE & Patt

Planned Treatment:

relevelled and reset Sept 2017; reset footstone

Actual Treatment: 8/24/2019

relevelled and reset Sept 2017; reset excavated "P.C." footstone in soil behind stone

20-01-IMG_7032



20-01-IMG_6067



20-01-IMG_6330



20-01-IMG_20190824_164554439



Marker: 20-09

Names: Roy L FORREST

Planned Treatment:

relevel only

Actual Treatment: 8/24/2019

relevelled; reset "R.F." footstone found at 21-11 in soil behind stone


20-09-IMG_7038



20-09-IMG_20190824_163613788



20-09-IMG_20190824_163600183

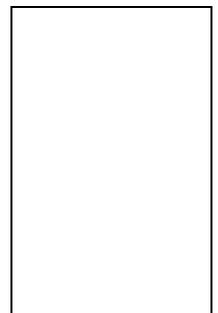

Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 21-08

Names: William E PAXSON

Planned Treatment:

see Preservation Plan for dislocated footstone protocol

Actual Treatment: 9/12/2019

blank footstone A16 moved to offsite storage


21-08-IMG_7048



A16-IMG_20190912_142751061



A16-IMG_20190912_143004096

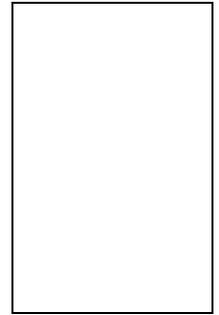

Marker: 21-10

Names: Owen F DUNN

Planned Treatment:

clean, examine base, relevel base, and reset

Actual Treatment: 8/15/2019

moved in new base from behind welcome sign, reset on new base in lime mortar, moved broken base to behind sign

21-10-IMG_7050



21-10-IMG_20190815_112130680



21-10-IMG_20190815_121144366



21-10-IMG_20190819_151216138



Marker: 21-11

Names: Irving DUNN & Susana DUNN

Planned Treatment:

relevel and reset

Actual Treatment: 8/15/2019

reveled and reset in lime mortar; "R.F." footstone found and moved to 20.09

21-11-IMG_7051



21-11-IMG_20190815_143255044



21-11-IMG_20190815_153246911



21-11-IMG_20190819_151156096



Marker: 22-03

Names: George W FOWLER

Planned Treatment:

relevel and reset

Actual Treatment: 8/2/2019

reveled and reset in lime mortar

22-03-IMG_7054



22-03-IMG_20190802_144051850



22-03-IMG_20190802_150748825



22-03-IMG_20190808_164437397



Marker: 22-04

Names: Bessie DORSEY

Planned Treatment:

relevel and reset

Actual Treatment: 7/1/2019

reveled and reset in epoxy (Akepox 2010); footstone "B.D." from 18-01 reset in soil behind base

22-04-IMG_7055



22-04-IMG_20190701_155057181



22-04-IMG_20190701_160044903



22-04-IMG_20190912_142637588



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 22-09

Names: May CRATER

Planned Treatment:
reset only

Actual Treatment: 8/12/2019
reset in lime mortar


22-09-IMG_7060



22-09-IMG_20190812_163917573



22-09-IMG_20190815_125416956

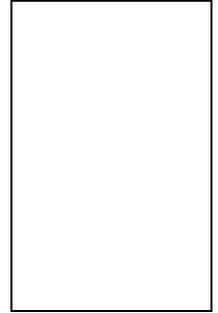

Marker: 23-03

Names: Ruth Norman BAKER

Planned Treatment:
relevel and reset

Actual Treatment: 7/1/2019
releveled and reset in lime mortar

23-03-IMG_7064



23-03-IMG_20190701_160956329



23-03-IMG_20190802_162140295



23-03-IMG_20190808_163826904



Marker: 23-07

Names: Lucia CLOSE

Planned Treatment:
relevel and reset

Actual Treatment: 7/1/2019
releveled, reset with epoxy, and trimmed with lime mortar; cleaned with water

23-07-IMG_7068



23-07-IMG_20190701_150311077



23-07-IMG_20190715_130245196



23-07-IMG_20190724_160008894



Marker: 23-08

Names: Birdie M RUSH

Planned Treatment:
clean, relevel, and reset; see Preservation Plan for dislocated footstone

Actual Treatment: 7/9/2019
releveled and reset stone in lime mortar; cleaned with water; footstones A18 and A19 to offsite storage

23-08-IMG_7069



23-08-IMG_20190709_145525680



23-08-IMG_20190711_125250236



23-08-IMG_20190724_160038041



Marker: 24-04

Names: J ARMS & Cora E ARMS

Planned Treatment:
no treatment needed other than cleaning

Actual Treatment: 9/12/2019
"J.A." footstone from 06-19 reset in soil at foot

24-04-IMG_7073



24-04-IMG_20190912_144133303_H



24-04-IMG_20190912_144500546_H



24-04-IMG_20190912_144630637_H



Markers Treated at Brookside Cemetery, Dayton, Oregon

Marker: 25-01

Names: Daniel SMITH

Planned Treatment:

relevel only

Actual Treatment: 7/29/2019

relevelled

25-01-IMG_7076



25-01-IMG_20190729_163830647



25-01-IMG_20190729_170803393



25-01-IMG_20190729_171251419



Appendix B: Objects to Storage

In September 2019, we took 19 stone items and 10 metal items from the cemetery to the city-owned, off-site storage. These items were “loose” in the cemetery and were subject to the [misplaced footstone protocol](#) described earlier in this report. For the most part, the stones removed were marble with either no markings or markings that did not make their proper location obvious. The metal items are mostly temporary grave markers with no identifying information.

Each “loose” item was labeled in pencil with an object number and put in a paper bag with its provenience and object number. This appendix contains the same information. The object number in a “A99” format, where “A” distinguishes stone and “B” distinguishes metal. A copy of this appendix should be placed with the artifacts in the off-site storage location in a zip-lock bag.

The off-site location is a storage locker in the former Fisher Farm storage building owned by the City. The five-bay, metal building is about 100 yards east of the intersection of Hwy 233 and Hwy 154. The storage locker is inside the westernmost bay of the green building.

Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: A01

Material: marble

Description: triangular fragment of marble with letters "CE"

Engraving: "ICE"?

Provenience: from 02-04

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A01-IMG_20190904_110728590



A01-IMG_20190904_113126371



ObjectNum: A02

Material: marble

Description: blank marble footstone


Engraving: blank

Provenience: from 02-04

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A02-IMG_20190904_113134267

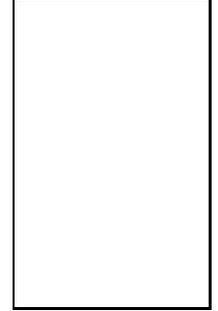

ObjectNum: A03

Material: marble

Description: blank marble footstone


Engraving: blank

Provenience: from 02-04

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A03-IMG_20190904_113143516

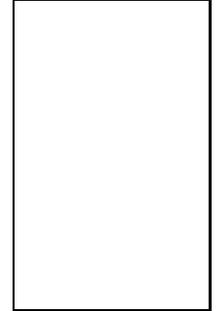

ObjectNum: A04

Material: stone

Description: stone fragment


Engraving: blank

Provenience: from 03-36

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A04-IMG_6650

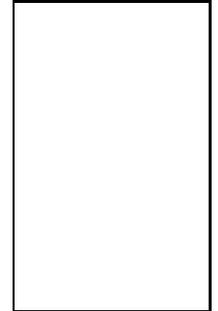

ObjectNum: A05

Material: marble

Description: blank marble footstone


Engraving: blank

Provenience: from 06-19

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A05-IMG_20190904_121050818

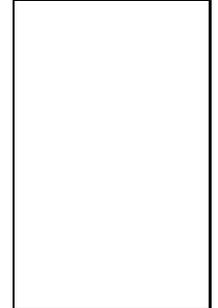

Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: A06 **Material:** marble

Description: marble fragment


Engraving: blank

Provenience: from 06-19

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A06-IMG_20190904_121050818

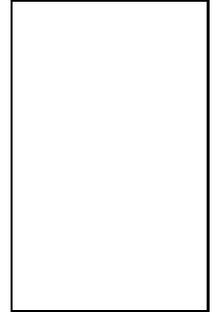

ObjectNum: A07 **Material:** stone

Description: stone fragment


Engraving: blank

Provenience: from 06-21

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A07-IMG_20190904_121221802

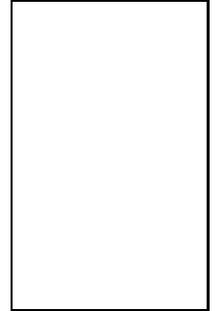

ObjectNum: A08 **Material:** marble

Description: blank marble fragment


Engraving: blank

Provenience: from 06-35

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A08-IMG_20190904_144757754

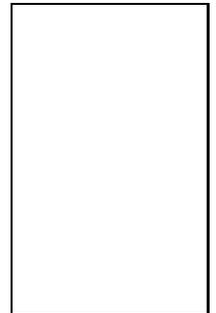

ObjectNum: A09 **Material:** marble

Description: two marble fragments


Engraving: blank

Provenience: from btw 08-11 and 08-12

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A09-IMG_20190904_154648733

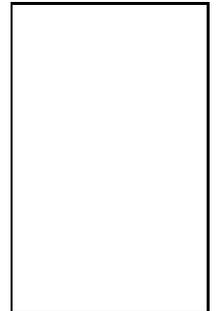

ObjectNum: A10 **Material:** marble

Description: three marble fragments


Engraving: blank

Provenience: from 08-16

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A10-IMG_20190904_155702937

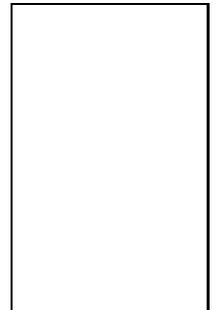

Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: A11 **Material:** marble

Description: marble footstone


Engraving: "W.H."

Provenience: from 09-21

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A11-IMG_6815

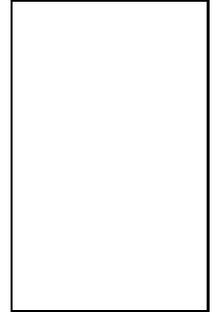

ObjectNum: A12 **Material:** marble

Description: marble footstone


Engraving: "G.S."

Provenience: from 11-19

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A12-IMG_20190904_164605192

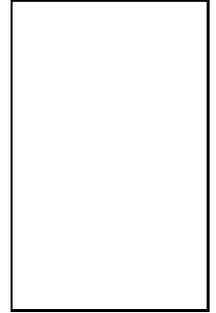

ObjectNum: A13 **Material:** marble

Description: blank marble footstone


Engraving: blank

Provenience: from 11-21

Treatment: 9/4/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A13-IMG_20190904_170843579

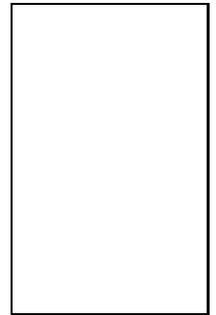

ObjectNum: A14 **Material:** stone

Description: eight pieces of one or two flat name plate

Engraving: "RANIE" perh

Provenience: from 12-11

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A14-IMG_20190912_111856509



A14-IMG_20190912_113317180



ObjectNum: A15 **Material:** marble

Description: blank marble footstone

Engraving: blank

Provenience: from 13-26

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A15-IMG_20190912_120004311



A15-IMG_20190912_120136673



Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: A16 **Material:** marble

Description: blank marble footstone

Engraving: blank

Provenience: from 21-08

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A16-IMG_20190912_142751061



A16-IMG_20190912_143004096



ObjectNum: A17 **Material:** marble

Description: marble fragment

Engraving: "GH"

Provenience: from 19-07

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A17-IMG_20190912_143044433



A17-IMG_20190912_143124602



ObjectNum: A18 **Material:** marble

Description: blank marble footstone

Engraving: blank

Provenience: from 23-08

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A18-IMG_20190912_143807690_HD



A18-IMG_20190912_143820798_HD



ObjectNum: A19 **Material:** marble

Description: marble footstone

Engraving: "FATHER"

Provenience: from 23-08

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

A19-IMG_20190912_143807690_HD



A19-IMG_20190912_143826758_HD



ObjectNum: B01 **Material:** metal

Description: temporary metal burial marker


Engraving: blank

Provenience: from 01-01

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B01-IMG_20190912_145159936

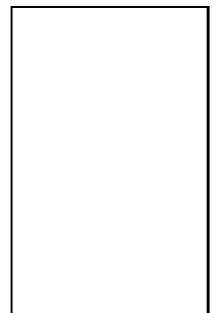

Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: B02 **Material:** metal

Description: temporary metal burial marker

Engraving: blank

Provenience: from btw 01-11 and 01-12

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B02-IMG_20190912_145436774_HD



B02-IMG_20190912_145455765_HD



ObjectNum: B03 **Material:** metal

Description: temporary metal burial marker


Engraving: blank

Provenience: from 09-17

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B03-IMG_20190912_150345284_HD

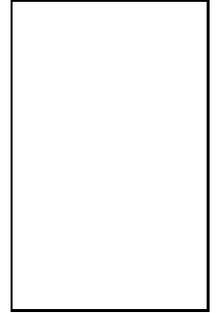

ObjectNum: B04 **Material:** metal

Description: temporary metal burial marker


Engraving: blank

Provenience: from 11-08

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B04-IMG_20190912_150748575_HD

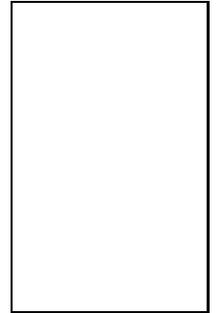

ObjectNum: B05 **Material:** metal

Description: rusty kitchen knife

Engraving: blank

Provenience: from 12-01

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B05-IMG_20190912_1511159350



B05-IMG_20190912_151204937



ObjectNum: B06 **Material:** metal

Description: temporary metal burial marker

Engraving: blank

Provenience: from 13-11

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B06-IMG_20190912_151401378



B06-IMG_20190912_151406330



Objects to Storage at Brookside Cemetery, Dayton, Oregon

ObjectNum: B07

Material: metal

Description: IOOF burial marker, FLT in three links


Engraving: blank

Provenience: from 13-16

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B07-IMG_20190912_152028459

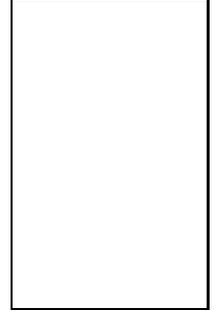

ObjectNum: B08

Material: metal

Description: rusty kitchen knife

Engraving: blank

Provenience: from 13-14

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B08-IMG_20190912_152327645



B08-IMG_20190912_152334611



ObjectNum: B09

Material: metal

Description: temporary metal burial marker


Engraving: blank

Provenience: from btw 22-01 and 22-02

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B09-IMG_20190912_153003232

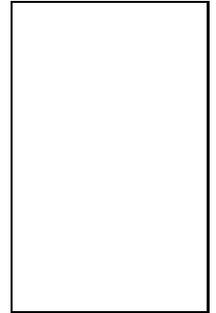

ObjectNum: B10

Material: metal

Description: temporary metal burial marker

Engraving: blank

Provenience: from 24-06

Treatment: 9/12/2019

labeled with object number in pencil, placed in labeled paper bag, and placed in offsite storage

B10-IMG_20190912_153621293



B10-IMG_20190912_153629885

